

# **Model 8710 DP-CALC™ Micromanometer**

Operation and Service Manual

*1980495, Revision C  
July 2006*



## LIMITATION OF WARRANTY AND LIABILITY

### Copyright©

TSI Incorporated / 2004-2006 / All rights reserved.

### Address

TSI Incorporated / 500 Cardigan Road / Shoreview, MN 55126 / USA

### Fax No.

(651) 490-3824

### LIMITATION OF WARRANTY AND LIABILITY (effective July 2000)

Seller warrants the goods sold hereunder, under normal use and service as described in the operator's manual, shall be free from defects in workmanship and material for twenty-four (24) months, or the length of time specified in the operator's manual, from the date of shipment to the customer. This warranty period is inclusive of any statutory warranty. This limited warranty is subject to the following exclusions:

- a. Hot-wire or hot-film sensors used with research anemometers, and certain other components when indicated in specifications, are warranted for 90 days from the date of shipment.
- b. Parts repaired or replaced as a result of repair services are warranted to be free from defects in workmanship and material, under normal use, for 90 days from the date of shipment.
- c. Seller does not provide any warranty on finished goods manufactured by others or on any fuses, batteries or other consumable materials. Only the original manufacturer's warranty applies.
- d. Unless specifically authorized in a separate writing by Seller, Seller makes no warranty with respect to, and shall have no liability in connection with, goods which are incorporated into other products or equipment, or which are modified by any person other than Seller.

The foregoing is IN LIEU OF all other warranties and is subject to the LIMITATIONS stated herein. **NO OTHER EXPRESS OR IMPLIED WARRANTY OF FITNESS FOR PARTICULAR PURPOSE OR MERCHANTABILITY IS MADE.**

TO THE EXTENT PERMITTED BY LAW, THE EXCLUSIVE REMEDY OF THE USER OR BUYER, AND THE LIMIT OF SELLER'S LIABILITY FOR ANY AND ALL LOSSES, INJURIES, OR DAMAGES CONCERNING THE GOODS (INCLUDING CLAIMS BASED ON CONTRACT, NEGLIGENCE, TORT, STRICT LIABILITY OR OTHERWISE) SHALL BE THE RETURN OF GOODS TO SELLER AND THE REFUND OF THE PURCHASE PRICE, OR, AT THE OPTION OF SELLER, THE REPAIR OR REPLACEMENT OF THE GOODS. IN NO EVENT SHALL SELLER BE LIABLE FOR ANY SPECIAL, CONSEQUENTIAL OR INCIDENTAL DAMAGES. SELLER SHALL NOT BE RESPONSIBLE FOR INSTALLATION, DISMANTLING OR REINSTALLATION COSTS OR CHARGES. No Action, regardless of form, may be brought against Seller more than 12 months after a cause of action has accrued. The goods returned under warranty to Seller's factory shall be at Buyer's risk of loss, and will be returned, if at all, at Seller's risk of loss.

Buyer and all users are deemed to have accepted this LIMITATION OF WARRANTY AND LIABILITY, which contains the complete and exclusive limited warranty of Seller. This LIMITATION OF WARRANTY AND LIABILITY may not be amended, modified or its terms waived, except by writing signed by an Officer of Seller.

### Service Policy

Knowing that inoperative or defective instruments are as detrimental to TSI as they are to our customers, our service policy is designed to give prompt attention to any problems. If any malfunction is discovered, please contact your nearest sales office or representative, or call Customer Service at (651) 490-2811 or (800) 874-2811.

# **Model 8710 DP-CALC™ Micromanometer**

## Operation and Service Manual

*1980495, Revision C  
July 2006*

**SHIP TO/MAIL TO:**

TSI Incorporated  
500 Cardigan Road  
Shoreview, MN 55126-3996  
USA

**U.S. & INTERNATIONAL**

**Sales and Customer Service:**  
(800) 874-2811 / +1 (651) 490-2811  
**Fax:**  
+1 (651) 490-3824

**E-mail address:**

[answers@tsi.com](mailto:answers@tsi.com)

**Website:**

<http://www.tsi.com>

**EUROPE**

**Sales and Customer Service:**

**TSI AB**

+46 8-595 132 30

**Fax:**

+46 8-595 132 39

**TSI GmbH**

+49 241-52 3 03-30

**Fax:**

+49 241-52 3 03-49



# CONTENTS

<b>About This Manual</b> .....	<b>iii</b>
Formatting and Typography .....	iii
Technical Assistance—Help! .....	iii
<b>Chapter 1. Introduction</b> .....	<b>1</b>
Instrument Description .....	1
Micromanometer .....	1
Micromanometer .....	2
Standard Tools.....	3
Pitot Tube.....	3
Static Pressure Probe .....	3
Optional Tools.....	3
Velocity Matrix.....	3
Air Flow Probe.....	3
Temperature Probe .....	3
Temperature/Humidity Probe .....	3
<b>Chapter 2. Unpacking and Setting Up</b> .....	<b>5</b>
Unpacking .....	5
Preparing the Instrument for Use .....	6
Power the Micromanometer with the AC Adapter .....	6
Power the Micromanometer with Batteries.....	6
Connecting the Pitot Tube to the Micromanometer.....	8
Connecting the Static Pressure Port to the Micromanometer .....	8
Connecting the Velocity Matrix to the Micromanometer.....	8
Connecting the Air Flow Probe to the Micromanometer .....	9
Connecting the Temperature Probe or Temperature and Humidity Probe to the Micromanometer .....	9
<b>Chapter 3. Getting Started</b> .....	<b>11</b>
Keypad Operation .....	11
Common Terms .....	12
Sample .....	12
Logging Interval.....	12
Test ID.....	12
Step-By-Step Example Operation .....	13
<b>Chapter 4. How To</b> .....	<b>15</b>
Select a Tool .....	15
Set the Time and Date .....	17
Change the Currently Selected Test ID .....	17
Recall Sample Data .....	17
Delete Sample Data.....	18
Delete all Sample Data .....	18
Delete the Samples Stored in a Single Test ID.....	18
Delete a Single Sample.....	18
Select/Set a K-factor for a Tool .....	19
View/Set Standard Pressure and Temperature .....	19
Set Units of Measure for Temperature, Pressure, Velocity/Flow and Humidity .....	21

Select the RS232 Output Device (Computer or Printer) .....	21
Set the Baud Rate.....	22
Set the Format for Date and Decimal.....	22
Set Display Mode for Running Average or Single.....	23
Select Discrete or Continuous Logging.....	23
Set Deadband On and Off.....	24
Calibrate the Micromanometer (User Calibration).....	24
Select User Calibration or Factory Calibration .....	25
Connect and Download Data to an Optional Printer .....	25
Connect and Download Data to a Computer .....	26
Data Acquisition (Polling).....	26
<b>Chapter 5. Maintenance and Troubleshooting .....</b>	<b>27</b>
Micromanometer .....	27
Velocity Matrix Manifold .....	27
Cases .....	27
Calibration.....	27
Error Code.....	28
<b>Appendix A. Actual vs. Standard Air Velocity and Flow Measurements .....</b>	<b>31</b>

# About This Manual

This manual explains how to set up, operate and maintain the TSI® Model 8710 DP-CALC™ Micromanometer. Read it thoroughly before using the instrument.

## Formatting and Typography

---

---

- ❑ Step-by-step instructions are numbered in boldface type: **1, 2, 3**, etc., set flush-left against the margin.
- ❑ References to keys on the micromanometer and the instrument's displayed readout are represented by a typeface called Arial. In addition to the different typeface, displayed messages appear in quotes.
- ❑ When reference is made to other sections of the manual, the section title is italicized.

## Technical Assistance—Help!

---

---

For technical assistance or questions about the instrument of this manual, or if the Model 8710 Micromanometer needs repair or recalibration, call Technical Support at (651) 490-2811 or (800) 874-2811. Product application notes are available to provide more information on the product. These application notes, as well as other related material, can be obtained by calling Customer Service or by visiting the TSI web site at <http://www.tsi.com>.



# Chapter 1. Introduction

The Model 8710 DP-CALC™ Micromanometer is a lightweight and easy-to-use instrument packaged with a variety of accessories for measuring pressure, temperature, humidity, air velocity, and air volume.

Features of the micromanometer include:

- ❑ Single-function keys for ease of use
- ❑ Auto-zero for pressure measurements and auto-density correction
- ❑ User-selectable English and metric units
- ❑ Conversions between actual and standard flow
- ❑ Discrete or continuous display and data logging capabilities
- ❑ Output port for downloading to a printer or a PC
- ❑ Powered by AC adapter or batteries (rechargeable NiMH or alkaline)
- ❑ Full field calibration

The Micromanometer is designed for:

- ❑ Test and balance professionals
- ❑ Mechanical contractors
- ❑ Industrial hygienists
- ❑ Plant engineers and facilities maintenance personnel

Applications include:

- ❑ Test, balance, or commission HVAC systems
- ❑ Test clean rooms and biological safety cabinets
- ❑ Measure fume hood or filter face velocity
- ❑ Measure pressure, temperature, relative humidity, air velocity, or air flow

## Instrument Description

---

The basic Model 8710 includes a micromanometer, carrying case, 18 in. (46 cm) pitot tube, (2) static pressure probes, (2) 8 ft (2.4 m) Norprene® tubing, user manual, LogDat™ for Windows® data downloading software and RS232 interface cable, neck strap, internal NiMH battery charger, (4) AA NiMH batteries, AC adapter, and NIST traceable certificate.

A variety of optional tools (*see below*) are also available to meet your measurement needs.


The following paragraphs provide brief descriptions of the micromanometer and the various standard and optional tools for use with the micromanometer. Refer to Chapters [3](#) and [4](#) for more detailed information on using the micromanometer and taking measurements with various sensors and probes.

### Micromanometer


Figures 1 and 2 show the features of the micromanometer.

---

®Norprene is a registered trademark of Norton Performance Plastics, Akron, Ohio, USA.

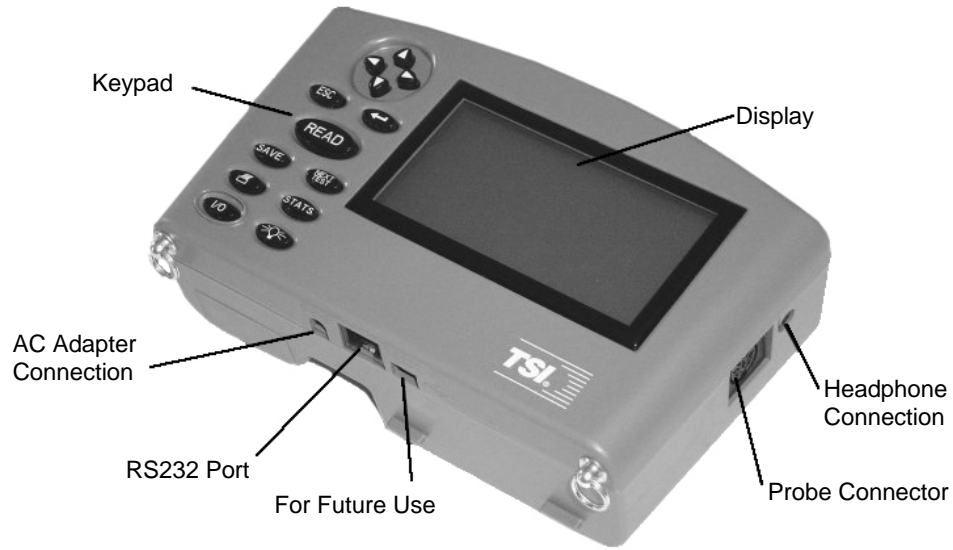

**Figure 1: Features of the Model 8710 DP-CALC Micromanometer, Front View**

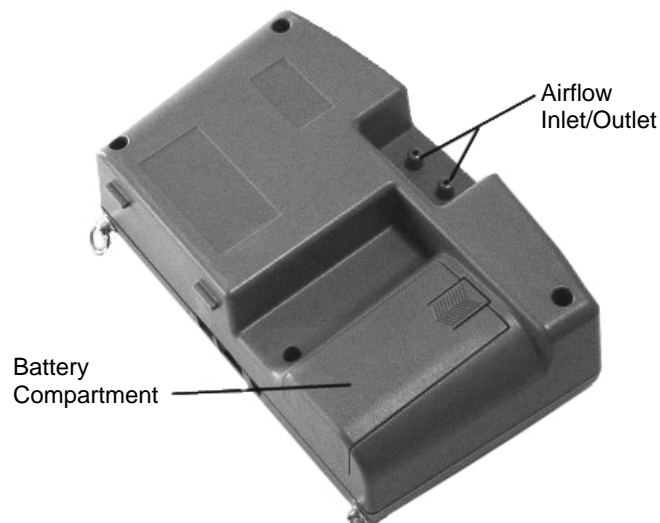

**Figure 2: Features of the Model 8710 DP-CALC Micromanometer, Back View**

## **Micromanometer**

---

The micromanometer is a multifunction instrument useful in obtaining air velocity, air flow, absolute and differential pressure, temperature, and humidity measurements when used with the tools listed below. The lightweight micromanometer incorporates auto-zeroing for high-accuracy, low-end pressure measurements.

## **Standard Tools**

---

This section gives a brief description of standard tools for the micromanometer.

### **Pitot Tube**

The pitot tube is primarily used to obtain air velocity, air volume, and velocity pressure measurements within ductwork.

### **Static Pressure Probe**

The static pressure probe is primarily used to obtain static pressure measurements within ductwork.

## **Optional Tools**

---

This section gives a brief description of optional tools for the micromanometer.

### **Velocity Matrix**

The velocity matrix is primarily used to obtain area-averaged multi-point air velocity measurements useful in laboratory hood face velocity testing, filter face velocity testing, and other applications.

### **Air Flow Probe**

The air flow probe is primarily used to obtain single point air velocity or air volume measurements in ductwork.

### **Temperature Probe**

The temperature probe is used to obtain temperature measurements over the range of -40 to 250°F (-40 to 121°C).

### **Temperature/Humidity Probe**

The temperature/humidity probe is used to obtain temperature measurements over the range of 14 to 140°F (-10 to 60°C), humidity measurements over the range of 0 to 95% RH, along with calculated wet bulb temperature of 40 to 140°F (4 to 60°C) and dewpoint temperature of 5 to 120°F (-15 to 49°C).



# Chapter 2. Unpacking and Setting Up

This chapter describes unpacking and setting up (preparing) the micromanometer for use. Figure 3 shows a picture of the Model 8710 with a velocity matrix measuring the face velocity on a laboratory hood.



**Figure 3: Model 8710 with Velocity Matrix**

## Unpacking

As you unpack the instrument and accessories, check the components against your packing list. If any parts are missing or damaged, notify us immediately. Tables 1 and 2 list available standard and optional components.

**Table 1: List of Standard and Optional Components**

Item	Part No./Model No.
TSI Model 8710 DP-CALC Micromanometer	8710-XXX
Carrying case	1319378
AA-size NiMH battery, four required	1208048
Operation and Service Manual	1980495
Velocity Matrix Add On Kit	801090
Air Flow Probe	800187
Printer, Serial (U.S.A. and Canada)	Contact TSI
12 in. (30 cm) Pitot Probe	634634000
18 in. (46 cm) Pitot Probe	634634001
24 in. (61 cm) Pitot Probe	634634002
36 in. (91 cm) Pitot Probe	634634003
60 in. (152 cm) Pitot Probe	634634005
Temperature Probe	800218
Temperature and Humidity Probe	800219
Battery Charger, includes 4 NiMH batteries	801093
AC Adapter (USA)	8710-USA
AC Adapter (EU)	8710-EUA
AC Adapter (UK)	8710-UKA
AC Adapter (AU)	8710-AUA

Please complete the registration card included with this product and mail it promptly. The card allows us to inform you of product updates. If you prefer, register through the TSI web site.

## Preparing the Instrument for Use

---

Before you can use the micromanometer, you must decide on a power source.

### Power the Micromanometer with the AC Adapter

When the AC adapter is plugged into the micromanometer, the unit automatically turns on, runs a brief diagnostic check, and briefly lights all segments of the display. It then displays the type of batteries the unit is set to use (alkaline or rechargeable NiMH) and turns itself OFF.


Whenever the AC adapter is plugged into the micromanometer, the rechargeable batteries are recharged. (Assuming you are using rechargeable batteries and the switch inside the battery compartment is set to NiMH. See below.)

### Power the Micromanometer with Batteries

When not using the AC adapter, the micromanometer requires four AA-size batteries to operate. These can be either alkaline batteries or rechargeable NiMH batteries. For your convenience, four NiMH batteries are included with the micromanometer.


To select the type of batteries you are using:

1. Turn the unit off and locate the battery cover on the back of the micromanometer (see Figure 4).

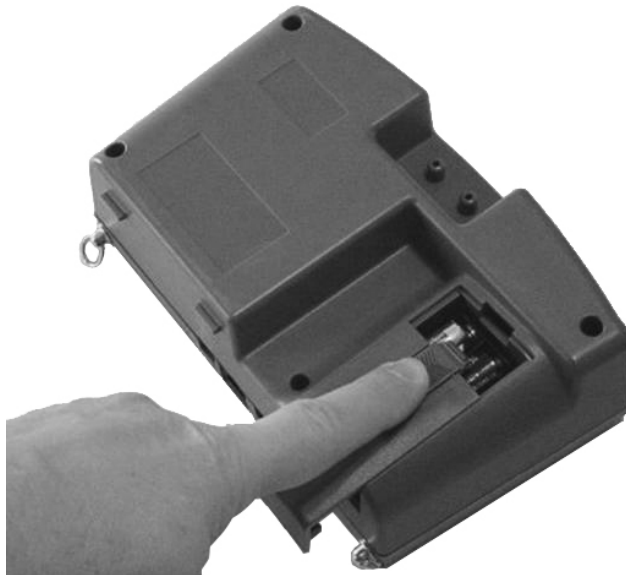

**Figure 4: Battery Cover Removal**

2. Press down on the compartment cover and slide it down. (The cover slides off.)
3. Remove the battery holder by pulling up on the bottom (to loosen it) and then pulling the battery holder free.
4. Refer to Figure 5 and set the battery selection switch to indicate the type of batteries you are using.

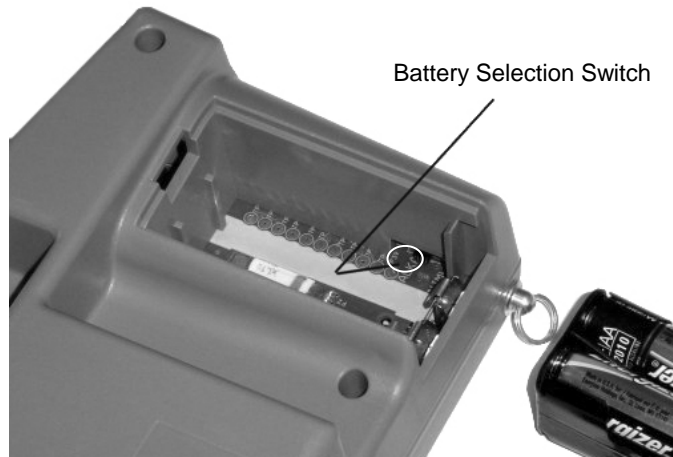

**Figure 5: Location of Battery Type Selector Switch**

5. Reinstall the battery holder and replace the battery compartment cover.

To install replacement batteries:

1. Turn the unit off and locate the battery cover on the back of the micromanometer (see Figure 4).
2. Press down on the compartment cover and slide it down. (The cover slides off.)
3. Remove the battery holder by pulling up on the bottom (to loosen it) and then remove the battery holder.
4. Remove the old batteries and replace with fresh batteries (alkaline or rechargeable NiMH). Make certain batteries are correctly oriented.
5. Verify the battery selection switch is correctly set (see Figure 5).
6. Reinstall the battery holder and replace the compartment cover.

**Note:** *Make sure the battery holder is oriented so that its terminals make contact with the spring contacts in the battery compartment.*

If fresh, new alkaline batteries are used, the battery indicator will show 4 bars when first turned on. With NiMH batteries, the indicator *may* show a lower value even when they are fully charged.

**Notes:** *The percent power remaining will not be accurate for NiMH batteries because their voltage does not decrease linearly with power use.*

*Due to the danger of battery leakage, remove batteries from the battery compartment before storage. Never mix battery types.*

*The NiMH batteries should only be charged at room temperature. Starting with batteries that are too cold or too warm can cause the charge cycle to stop early.*

## Connecting the Pitot Tube to the Micromanometer

---

The static pressure port (-) on the pitot tube will be connected to the negative pressure (-) port on the micromanometer, and the total pressure port (+) on the pitot tube will be connected to the positive (+) port on the micromanometer (see Figure 6).

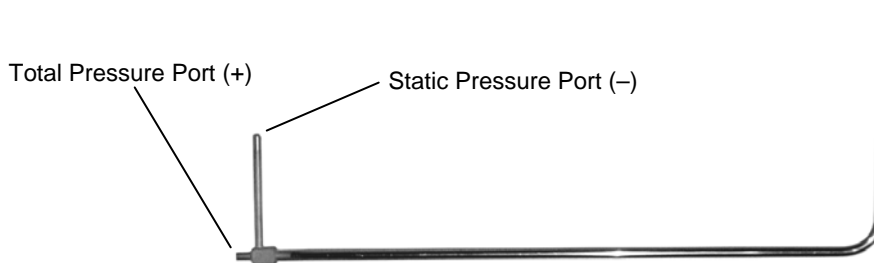


Figure 6: Pitot Tube

## Connecting the Static Pressure Port to the Micromanometer

---

The static pressure port on the static pressure probe will be connected to the (+) port on the micromanometer. The (-) port on the micromanometer will be open to atmosphere (see Figure 7).

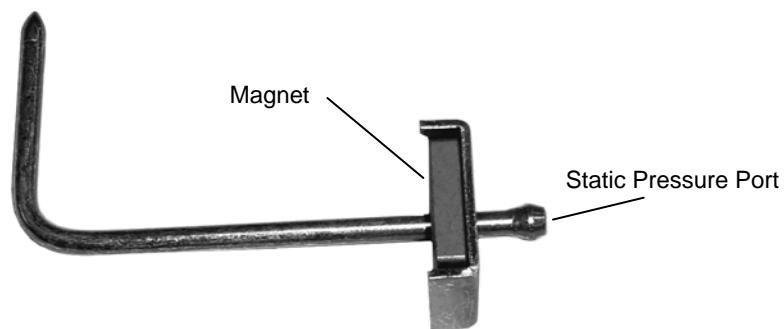



Figure 7: Static Pressure Probe

## Connecting the Velocity Matrix to the Micromanometer

The positive port (+) is located on the side of the Velocity Matrix that is opposite the handle assembly. The positive port (+) on the Velocity Matrix will be connected to the (+) port on the micromanometer, and the negative port (-) on the Velocity Matrix is connected to the (-) port on the micromanometer.

Standoffs can be screwed together to make different lengths and are used to maintain a fixed and level orientation away from a filter. The standoffs are attached to the positive (+) side of the velocity matrix.

The handle assembly is attached to the downstream or negative (-) side in the center of the velocity matrix (see Figure 8).

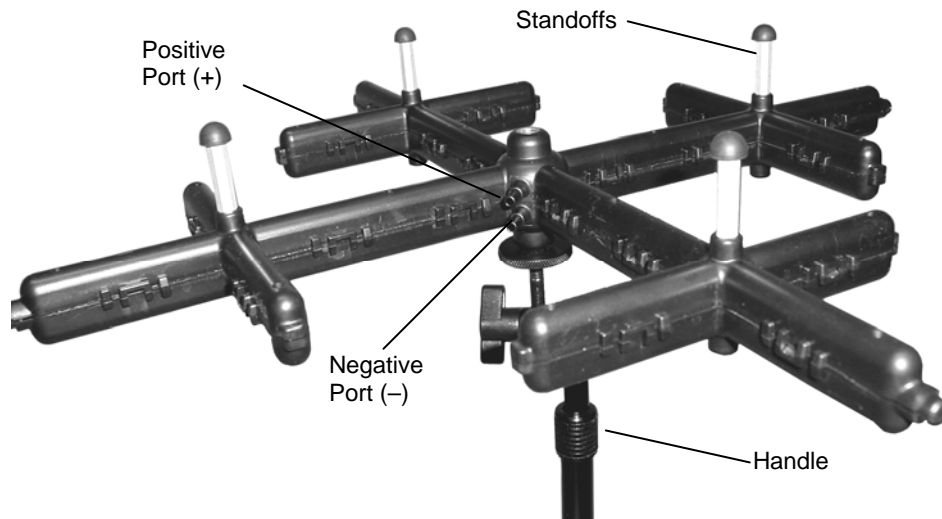


**Figure 8: Velocity Matrix**

## Connecting the Air Flow Probe to the Micromanometer

---

The static pressure port (-) on the Air Flow Probe will be connected to the negative pressure (-) port on the micromanometer, and the total pressure port (+) on the Air Flow Probe will be connected to the positive (+) port on the micromanometer (see Figure 9).

*Note: Observe the arrow indicator on the Air Flow Probe when taking air velocity or air volume measurements.*

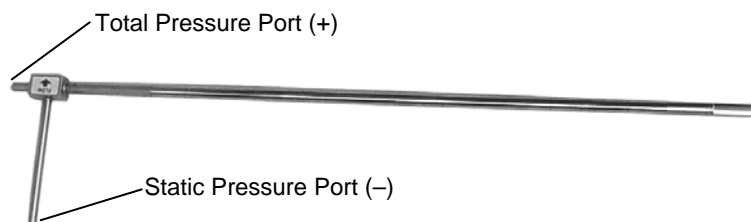


**Figure 9: Air Flow Probe**

## Connecting the Temperature Probe or Temperature and Humidity Probe to the Micromanometer

---

The Temperature probe and Temperature/Humidity probe attach to the 8-pin connector located on the right hand side of the micromanometer. When connecting the probe to the meter, the dimple on the connector must be aligned to fit the receptacle indentation on the meter (see Figure 10).

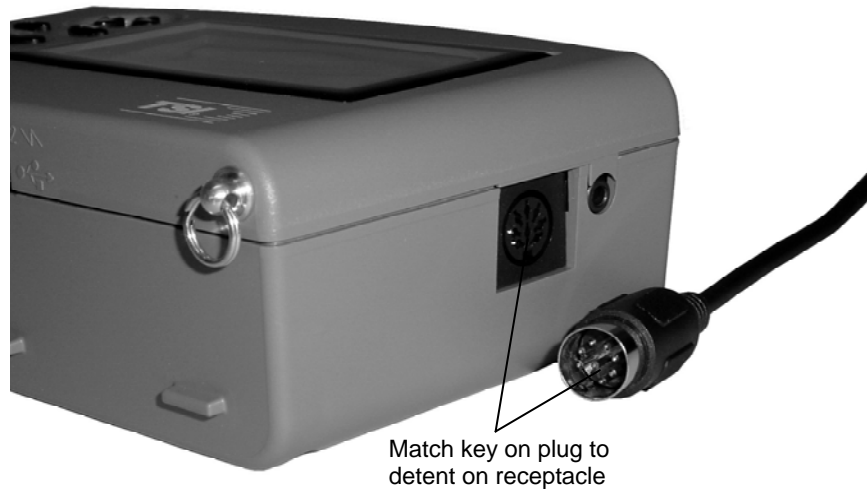

**Figure 10: Connector for the Temperature Probe or Temperature/Humidity Probe**

# Chapter 3. Getting Started

This section provides information to help you quickly become familiar with the Model 8710 Micromanometer functions. It also includes step-by-step instructions for taking Sample readings.

## Keypad Operation

---

The keypad lets you enter information, initiate functions, and change values stored in the micromanometer. It will be helpful before operating the micromanometer to understand more fully what each of the keys do.

### ◀▶▼ and▲

The arrow keys let you navigate through menus or select options. Generally only one set of arrow keys (▲,▼ or ◀,▶) are operational for any given operation. Use ◀ and ▶ to move through menus; use ▲ and ▼ to increase or decrease a value.

### ESC

The ESCAPE key is used to cancel or end an operation or back up to the last screen of displayed information. The ESC key is useful if you press ← and realize you meant to use one of the other keys.



The ENTER key is used to accept the present value or move to the next level of a menu.

### READ

If the display mode is set to SINGLE, pressing the READ key begins a reading, which stops automatically when the reading is done.

If the display mode is set to RUNAVG, the micromanometer will measure continuously, and pressing READ will alternately pause or resume the measurement. (See Chapter 4 on how to set the display mode to SINGLE or RUNAVG.)

*Note: Pressing the READ key will not store any measurement to memory.*

### SAVE

The SAVE key is used to save the currently displayed measurement to the data logging memory.

### NEXT TEST

The NEXT TEST key is used to select a new unused Test Id for saving Samples when logging data.



The PRINT key downloads data to an optional printer or to a computer. Refer to Chapter 4 for information on downloading data.

### STATS

The STATISTICS key lets you display COUNT, MINimum, MAXimum and AVerage for the Test ID currently selected for logging data.

### I/O

The ON/OFF key is used to turn the micromanometer on or off.



The **BACKLIGHT** key turns the display's backlighting on and off. Use backlighting only when working in areas where you cannot read the display with existing light. Backlighting has a significant impact on battery life.

---

## Common Terms

---

In this manual there are several terms that are used in different places. The following is a brief explanation of the meanings of terms.

### Sample

A Sample consists of all of the measurement parameters stored each time the **SAVE** key is pressed, or after each logging interval has passed. The maximum number of Samples is 1000.

### Logging Interval

The Logging Interval is the frequency period that the micromanometer will log readings, when logging is set to **CONTIN** (continuous). For example, if logging is set to **CONTIN** and the logging interval is set to 60 seconds, a Sample can be taken and saved automatically every 60 seconds. Refer to chapter 4 for more information on continuous data logging.

### Test ID

A Test ID consists of a group of Samples. A Test ID can contain up to 1000 Samples. The maximum number of Test IDs is 255.

Any new Sample will be saved to the current Test ID. You can change the current Test ID at any time to keep your data organized, refer to instructions in Chapter 4.

The unit does not allow you to store Samples of different character in the same Test ID. If the **READ** key is pressed after changes have been made to the Tool or display units or some other parameter, **TEST ID** flashes on the display and a new unused **TEST ID** is selected.

In addition to the data for each Sample, the statistics that are available to view by **TEST ID** are:

**SUM** - The sum of all stored values in that **TEST ID**. (**SUM** is only available for Diffuser Flow [flow from pressure and K-Factor])

**MINIMUM** - The lowest value stored in that **TEST ID**

**MAXIMUM** - The highest value stored in that **TEST ID**

**AVERAGE** - The **SUM** divided by the number of Samples

**COUNT** - The number of Samples in that **TEST ID**

Once you have collected data in a Test ID, you can send it to a printer or a computer. See instructions for downloading data in Chapter 4.

## Step-By-Step Example Operation

---

The quickest way to become acquainted with the operation of the micromanometer is to take a few Samples while in the pressure mode.

To take Samples proceed as follows:

1. Connect the AC adapter to the micromanometer or install batteries in the micromanometer (see [Chapter 2](#)).
2. Turn on the micromanometer by pressing the I/O key. The unit displays INIT (initializing) and runs a brief diagnostic test.
3. If the display mode is set to SINGLE, the unit will stop and show READY on the display. Pressing READ will begin a reading, which stops automatically when the reading is done. If the display mode is set to RUNAVG, the micromanometer will start measuring continuously, and pressing READ will pause and resume the measurement. (See [Chapter 4](#) on how to set the display mode to SINGLE or RUNAVG.)
4. While the unit reads the measurements, it makes a “clicking” sound.
5. When data collection is finished, the display shows the pressure reading. Press the SAVE key to save the displayed reading to the currently selected Test ID. (If the SAVE key is pressed before the micromanometer has collected enough data to save, NO.DATA is displayed.)
6. Repeat steps 4-5 to save additional Samples.

Refer to Chapter 4 for detailed “[How To](#)” information on recalling the saved Samples and many other specific operations.



# Chapter 4. How To

This chapter explains how to perform a variety of operations:

- ❑ Select a Tool/Probe
- ❑ Set the Date and Time
- ❑ Change the current Test ID
- ❑ Recall Sample Data
- ❑ Delete Sample Data
- ❑ Delete All Sample Data
- ❑ Select/Set a K-factor
- ❑ View/Set Standard Pressure and Temperature
- ❑ Set Units of Measure for Temperature, Pressure, Flow and Humidity
- ❑ Select the RS232C Output Device (Computer or Printer)
- ❑ Set the Baud Rate
- ❑ Set the Date and Decimal Format
- ❑ Set Display Mode for Running Average or Single
- ❑ Select Discrete or Continuous Logging
- ❑ Set Deadband On and Off
- ❑ Calibrate the Micromanometer
- ❑ Select User vs. Factory Calibration
- ❑ Connect and Download to a Printer
- ❑ Connect and Download to a Computer
- ❑ Data Acquisition (Polling)

*Note: The operations described below assume you are starting from the READY display. As you use the instrument, you will find it unnecessary to return to the READY display each time. Press the ESC key (one or more times) to return to the READY display.*

## Select a Tool






---

The instrument accepts a number of different measurement devices, referred to as Tools. The Tools are:

- ❑ A velocity matrix for area-averaged multi-point velocity measurements.
- ❑ Pitot tubes for flow and velocity measurements.
- ❑ Air Flow probes for flow and velocity measurements.
- ❑ A Diffuser Flow tool which can calculate flow for diffusers equipped with differential pressure taps. (The Diffuser Flow tool is a flow calculation method, not a physical device.) For the Diffuser Flow tool, flow is calculated from the square root of pressure times a user entered K-factor.

Table 2 identifies each Tool and the units of measure available for that tool.

**Table 2: Tool Selection Display**

Display Shows	Tool	Units Available
Pressure units only	Pressure	in H <sub>2</sub> O, mm H <sub>2</sub> O, cm H <sub>2</sub> O, Pa, hPa, kPa, mm Hg, cm Hg, in Hg,
Pressure units with K-factor and flow units	Diffuser Flow	l/s, m <sup>3</sup> /hr, m <sup>3</sup> /min, CFM
 with flow units	Air Flow Probe Flow	l/s, m <sup>3</sup> /hr, m <sup>3</sup> /min, CFM
 with velocity units	Air Flow Probe Velocity	ft/min, m/s
 with flow units	Pitot Tube Flow	l/s, m <sup>3</sup> /hr, m <sup>3</sup> /min, CFM
 with velocity units	Pitot Tube Velocity	ft/min, m/s
	Velocity Matrix	ft/min, m/s

To select a Tool, proceed as follows:

1. Press **←** to display **CHANGE Test ID**.
2. Press **▶** until **TOOL** appears.
3. Press **←**. The display shows an icon and units (see Table 3 above) to indicate the currently selected **TOOL** and the units selected for it.
4. Press **▲** or **▼** to scroll through the available **TOOLS**. See Table 3 above.
5. When the **TOOL** you want to use is displayed, press **←**.
6. If you select “flow” using either a pitot tube or an Air Flow probe, the display will flash a **○** and **□**. This indicates that you need to enter the duct shape and duct size. Proceed with steps 7-10. If you selected another **TOOL**, you will return to the **TOOL** menu.

*Note: The only way to change the duct shape or size later is to re-enter the Tool select menu and re-select the Tool.*

7. Use **▲** or **▼** to select the duct shape and stop the flashing.
8. Press **←**. The display shows the currently selected duct size (flashing).
9. Use **▲** or **▼** to change the size. (If you selected a rectangular size, you need to enter/change the size for both height and width, even if the duct is square. Change the x dimension first, then press **←** and change the y dimension).
10. Press **←** to exit to the **TOOL** menu.

## Set the Time and Date

---

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until TIME is displayed.
5. Press **←**. The display shows the current time and date. The hours value is flashing.
6. Use **◀** and **▶** to move between values and **▲** and **▼** to adjust values.
7. Press **←** when you have set the time and date as desired.

*Note:* You can change the date format (see “[Set Format](#)” below). Allowable formats are mm.dd and dd.mm.

## Change the Currently Selected Test ID

---

To change the Test ID in which Samples will be stored, proceed as follows:

1. Press **←** to display CHANGE Test ID.
2. Press **←** to display the current Test ID.
3. Use **▲** and **▼** to select the Test ID you want to use.

*Note:* If you press **▲** again after the highest numbered Test ID is displayed, you will add a new Test ID. (The Test ID is empty until you send Samples to it.) Also, if you press **SAVE** (or try to automatically log data to a Test ID) and the Tool or display units or measurement parameters are different from the information already stored in the currently selected Test ID, the instrument will automatically change the currently selected Test ID to a new unused Test ID. See the description of “[TEST IDs](#)” in Chapter 3.

## Recall Sample Data

---

To recall Sample data so that you can review it or send it to a printer or computer, proceed as follows:

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until RECALL appears.
3. Press **←** to display the current Test ID.
4. Use **▲** and **▼** to select the Test ID you want to recall a Sample from.
5. Press **←**. The COUNT for the selected Test ID is displayed. (Count is the number of Samples in the Test ID.)

Press **▲** or **▼** to display an entry in the selected Test ID. In addition to displaying individual Sample values, you can also view the MAX, MIN, AVG, and SUM of the data in the Test ID. (SUM is only available for Diffuser Flow [flow from pressure and K-Factor].) Hold down **▲** or **▼** to scroll quickly through the data.

## Delete Sample Data

---

You can delete data in three ways: 1) delete all Sample data in all Test IDs, 2) delete all Sample data for a single Test ID, and 3) delete only the last Sample currently stored in a Test ID.

### Delete all Sample Data

1. Press  $\leftarrow$  to display CHANGE Test ID.
2. Press  $\blacktriangleright$  until DELETE appears.
3. Press  $\leftarrow$ . The display shows DELETE ALL.
4. Press  $\leftarrow$ . The instrument counts down from 3 to 0 and then deletes all Sample data.

*Note: This countdown gives you time to change your mind. If you decide not to delete all samples after pressing  $\leftarrow$ , press ESC before the count reaches 0. Samples will **not** be deleted.*

### Delete the Samples Stored in a Single Test ID

1. Press  $\leftarrow$  to display CHANGE Test ID.
2. Press  $\blacktriangleright$  until DELETE appears.
3. Press  $\leftarrow$ . The display shows DELETE ALL.
4. Press  $\blacktriangleright$ . The display shows DELETE Test ID.
5. Press  $\leftarrow$ . The display shows the currently selected Test ID.
6. Use  $\blacktriangle$  and  $\blacktriangledown$  to display the Test ID whose Samples you want to delete.
7. Press  $\leftarrow$ . "DELETE" flashes while all Samples for the selected Test ID are deleted.
8. Repeat steps 6 and 7 to delete other Test IDs.

### Delete a Single Sample

1. Press  $\leftarrow$  to display CHANGE Test ID.
2. Press  $\blacktriangleright$  until DELETE appears.
3. Press  $\leftarrow$ . The display shows DELETE ALL.
4. Press  $\blacktriangleright$ . The display shows DELETE Test ID.
5. Press  $\blacktriangleright$ . The display shows DELETE #.
6. Press  $\leftarrow$ . The display shows the currently selected Test ID.
7. Use  $\blacktriangle$  and  $\blacktriangledown$  to display the Test ID containing the Sample you want to delete.
8. Press  $\leftarrow$ . The display shows the last Sample in the Test ID.
9. Press  $\leftarrow$ . "DELETE" flashes while the last Sample of the selected Test ID is deleted.
10. Repeat step 9 to delete other Samples in the selected Test ID.

## Select/Set a K-factor for a Tool

---

It is possible to enter K-Factors to adjust the calculations of the velocity and flow measurements.

For Pitot Velocity, Pitot Flow, Air Flow Probe Flow, Air Flow Probe Velocity and Velocity Matrix, the K-Factor is simply multiplied by the calculated velocity or flow in order to get the displayed value. For these Tools, use of a K-Factor is optional and setting the K-Factor to 1.0 will turn it off. The K-factor range for these Tools is 0.500 to 1.500.

For the Diffuser Flow Tool (Flow from Pressure and K-factor), the use of a K-Factor is mandatory. The displayed flow for this tool is the square root of pressure times the entered K-Factor. The K-factor range for this Tool is 0.001 to 9.999.

You can only enter a K-factor if you have selected a Tool that can use a K-factor. The Pressure Tool does not use K-factors.

To select or set a K-factor, proceed as follows:

1. Press **←** to display **CHANGE Test ID**.
2. Press **▶** until **K-FACT** appears.
3. Press **←**. The K-factor currently being used flashes on the display.
4. Press **▶** to scroll through the available K-factors or turn the K-factor Off. The instrument lets you set four K-factors for each tool that uses a K-factor.
5. If you want to change the value of a K-factor, use **▲** and **▼** to change the K-factor to the value desired.
6. Press **←** to accept the desired K-factor. **K-FACT** is displayed.
7. You can repeat steps 3–6 to select and/or adjust other K-factors for the Tool. Once you set a K-factor it remains set until you change it.

## View/Set Standard Pressure and Temperature

---

Temperature and barometric pressure are used for calculating some of the flow and velocity measurements shown by this instrument, as follows:

For the Pitot Flow, Pitot Velocity, Air Flow "Flow", Air Flow Velocity, and Velocity Matrix, the instrument uses barometric pressure measured by an internal barometric pressure sensor.

For these tools, the instrument will also use temperature measured by a temperature sensor plugged into the side of the meter.

The accessory temperature probe, or the accessory temperature/humidity probe can be used for supplying this temperature measurement. If none of these temperature sensors are plugged in, you will need to enter the flow temperature using the **STP.SET** menu.

For the Diffuser Flow tool (Flow from Pressure and K-factor), temperature and barometric pressure are not used for calculating flow. Therefore the user is not required to enter a temperature for this tool.

To display the Barometric Pressure:

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until STP.SET appears.
3. Press **←**. ACT.STD is displayed.
4. Press **▶** until B.PRESS appears. The measured barometric pressure is displayed. Barometric pressure is not changeable by the user.
5. Press ESC to return to the STP.SET menu.

To view the Measured Temperature and set the Entered Temperature:

*Note: Since the entered temperature is not used for the Diffuser Flow tool (Flow from Pressure and K-factor), this ENT.MES menu screen is not available if that tool is selected.*

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until STP.SET appears.
3. Press **←**. ACT.STD is displayed.
4. Press **▶** until ENT.MES appears.
5. Press **←**. The display shows the user ENTERed temperature on the left and the currently MEaSured temperature on the right (If a temperature sensor is plugged in).
6. Adjust the user entered temperature using **▲** and **▼**, then press **←** to save it and return to the STP.SET menu.

*Note: To save time, if a temperature probe is installed, you can copy the measured temperature to the entered temperature, by pressing READ.*

*ENTERed temperature is used for density correction of velocity or flow values only if no temperature probe is connected. If a temperature probe is connected during velocity or flow measurement, MEaSured temperature will be used for density correction. For most accurate density correction, be sure the connected temperature probe is exposed to the temperature of the flow or velocity being measured.*

To Select Actual Flow/Velocity or Standard Flow/Velocity:

(The Actual/Standard selection is used for all tools displaying flow and velocity except the Diffuser Flow [Flow from Pressure and K-factor] tool.)

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until STP.SET appears.
3. Press **←**. ACT.STD is displayed.
4. Press **←**. The display shows the currently selected option (flashing). Options are ACTUAL and STD.
5. Use **▲** or **▼** to select the option you want to use.
6. Press **←**. ENT.MES is displayed.
7. Press ESC to return to the STP.SET menu.

## Set Units of Measure for Temperature, Pressure, Velocity/Flow and Humidity

---

---

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until UNITS appears.
5. Press **←**. The display shows TEMP.
6. Press **←**. The display shows the current temperature units. Options are °F or °C.
7. Use **▲** and **▼** to select between options.
8. Press **←** when you have selected the desired units.
9. Press **▶** until PRESS is displayed.
10. Press **←**. The display shows the current pressure units. Options are: in. H<sub>2</sub>O, cm. H<sub>2</sub>O, mm H<sub>2</sub>O, in. Hg, cm. Hg, mm Hg, kPa, hPa, and Pa.
11. Use **▲** and **▼** to select between options.
12. Press **←** when you have selected the desired units.
13. Press **▶** until VELFLO is displayed.
14. Press **←**. The display shows the current velocity/flow units. Options are ft/min for velocity with CFM for flow, and m/s for velocity with either l/s, m<sup>3</sup>/h, or m<sup>3</sup>/min for flow.
15. Use **▲** and **▼** to select between options. (If m<sup>3</sup>/h, or m<sup>3</sup>/min is selected for flow, m/s will be used for velocity even though “m/s” is not shown on the display.)
16. Press **←** when you have selected the desired units.
17. Press **▶** until HUMID is displayed.
18. Press **←**. The display shows the current humidity units. Options are DEWPT, WETBULB, and %RH.
19. Use **▲** and **▼** to select between options.
20. Press **←** when you have selected the desired units.
21. Press ESC twice to return to SETUP.

## Select the RS232 Output Device (Computer or Printer)

---

---

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until COM.DEV appears.
5. Press **←**. The display shows the current selection: PRINTR or COMPU.

6. Press ▲ or ▼ to change device.
7. Press ←. COM.DEV is displayed.
8. Press ESC to return to SETUP.

## Set the Baud Rate

---

Before transferring data to a computer or printer, you must set the baud rate to the speed at which your printer or computer will accept information.

1. Press ← to display CHANGE Test ID.
2. Press ► until SETUP appears.
3. Press ←.
4. Press ► until BAUD appears.
5. Press ←. The display shows the currently selected baud rate.
6. Press ▲ or ▼ to change the baud rate. Options are: 19200, 9600, 4800, 2400, and 1200.
7. Press ←. BAUD is displayed.
8. Press ESC to return to SETUP.

## Set the Format for Date and Decimal

---

The Format option lets you set the format for the date (mm/dd or dd/mm) and also for the delimiter (. or ,) the instrument uses.

1. Press ← to display CHANGE.
2. Press ► until SETUP appears.
3. Press ←.
4. Press ► until FORMAT appears.
5. Press ←. The currently selected format appears.
6. Press ▲ or ▼ to change the format. Options are:
  - Peri nndd (use a period for the delimiter and show date as month/day)
  - Peri ddnn (use a period for the delimiter and show date as day/month)
  - Conn nndd (use a comma for the delimiter and show date as month/day)
  - Conn ddnn. (use a comma for the delimiter and show date as day/month)
7. Press ← to select the new format. FORMAT is displayed.
8. Press ESC to return to SETUP.

## Set Display Mode for Running Average or Single

---

If Single is selected, the instrument will show READY on its display, and will not start taking readings until READ is pressed.

If Running Average is selected, the instrument will constantly measure and display a running average. The READ button can then be used to stop and start the running average.

1. Press **←** to display CHANGE Test Id.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until DS.MODE appears.
5. Press **←**. The display shows the currently selected display mode. Options are: RUNAVG and SINGLE.
6. Press **▲** or **▼** to change the display mode.
7. Press **←**. DS.MODE is displayed.
8. Press ESC to return to SETUP.

## Select Discrete or Continuous Logging

---

Discrete logging means you have to press SAVE each time you want to save a displayed reading. Continuous logging means reading and saving is done automatically at the user-selectable Sample Logging Interval. Then the continuous logging is started and stopped by pressing SAVE.

1. Press **←** to display CHANGE.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until LOG appears.
5. Press **←**. The display shows the currently selected option. Options are: DISCRT and CONTIN.
6. Press **▲** or **▼** to change the logging option.
7. Press **←**. If you selected DISCRT, LOG is displayed. Continue with step 9. If you selected CONTIN, the display shows LOG.INT to indicate you must enter a logging interval.
8. Press **▲** and **▼** to select the logging interval. Options are (in sec.): 10, 15, 20, 30, 60, 120, 180, 240, 300, 360, 420, 480, 540, and 600.
9. Press **←**. LOG is displayed.
10. Press ESC to return to SETUP.

## Set Deadband On and Off

---

The deadband determines the velocity or volume measurement threshold for displaying 0. If the deadband is ON, readings below 18 fpm (0.0914 m/s) or 18 cfm (30.58 m<sup>3</sup>/h, 8.49 l/s) will be displayed as 0. If the deadband is OFF, readings down to 0 will be displayed. The default is set to ON.

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until SETUP appears.
3. Press **←**.
4. Press **▶** until DEADbAnd appears.
5. Press **←**. The display shows whether DEADbAnd is on or off.
6. Press **▲** or **▼** to change the option. Options are: ON and OFF.
7. Press **←**. DEADbAnd is displayed.
8. Press ESC to return to the main display.

## Calibrate the Micromanometer (User Calibration)

---

A full instrument checkout and calibration with a calibration certificate is available from the factory. However, some users prefer to calibrate their own instruments. Pressure, temperature and humidity can be calibrated in the field.

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until CALIB appears.
3. Press **←**. The display shows CALIB plus which measurement is selected for calibration.
4. Press **▶** until the desired measurement to calibrate is shown.
5. Press **←**. The display shows SPAN and the requested calibration condition is shown on the bottom left. If the current measurement is available for display, it will be shown on the bottom right.
6. Try to expose the sensor being calibrated to a condition close to the requested calibration condition on the lower left. Press **▲** or **▼** to change the value shown on the lower left to the actual value you want the display to read under that condition.
7. Press **←**. The display will show the next desired span condition. Repeat steps 6–7 until the display shows DONE. If any errors are shown on the display it is because the user calibration data taken is too much different from the factory calibration data. Error codes are explained at the end of [Chapter 5](#).

*Note: The calibration for the accessory temperature/humidity probe is saved on an EEPROM in the probe. If that probe is unplugged and used in a different micromanometer, the calibration will follow the probe. The calibration for the temperature probe is saved in the micromanometer. If those probes are unplugged and used in a different manometer, the calibration will **not** follow the probe.*

## Select User Calibration or Factory Calibration

---

Performing a user calibration does not erase the factory calibration because the user calibration is saved in a different place than the factory calibration. It is possible to re-select whether the micromanometer uses the user or factory calibration at any time.

1. Press **←** to display CHANGE Test ID.
2. Press **▶** until CALIB appears.
3. Press **←**. The display shows CALIB plus which measurement is selected for calibration.
4. Press **▶** until the display shows SOURCE U-F for the desired measurement.
5. Press **←**. The display shows SOURCE and whether USER or FACT is selected for that measurement.
6. Press **▲** or **▼** to select USER or FACT.
7. Press **←** to save the selection.

*Note:* For the accessory temperature/humidity probe it is not possible to mix user and factory calibrations for the different measurements. For example, USER cannot be selected for temperature with FACT selected for humidity.

## Connect and Download Data to an Optional Printer

---


To connect a printer, use the RS232 printer cable supplied with the optional printer. Note that the printer interface cable is different from the computer interface cable.


The printer must be set to the same baud rate as the instrument. To change the baud rate of the printer, refer to the printer's operations manual. Always turn the instrument on *before* the printer. If the printer prints question marks (?????), asterisks (\*\*\*\*\*), or random characters, reset it by turning it off and then on again. Figure 11 illustrates the printout information for a single sample.


```
-----  
MODEL: 8710 DP-Calc  
  
SERIAL: 0404004  
-----  
TEST ID:    2  
Sample:    1  
02/16/06  
15:14:31      1.00 CFM  
Shape=Round  
Dia =    4.0  in. ø  
Entered Temp=    74.4 °F  
Baro. Press=  29.16 in.Hg  
15:14:31      28.5 %rh
```

**Figure 11: Sample Print Out**

The Model 8710 allows printing of the entire memory, all Samples stored within a particular Test ID, or an individual Sample.

To print the entire memory, press and hold the  key. This starts a countdown from 3 to 0 on the display. When the display shows “0”, release the button. If you release the key at any time other than 0 during the countdown, nothing will print. The display will flash “Send dAtA” while printing.

To print all samples stored within a particular Test ID, first enter the RECALL menu. Select the desired Test ID to print using the up/down arrow keys. Then press and release the  key. The display will flash “Send dAtA” while sending.

To print an individual sample, first enter the RECALL menu. Select the Test ID containing the desired sample using the up/down arrow keys and press . Use the up/down arrow keys to scroll thru MIN, MAX, etc until the desired Sample is displayed. Then press and release the (print icon) key. The display will flash “Send dAtA” while sending.

## Connect and Download Data to a Computer

Use the RS232 computer interface cable (provided) to connect the instrument to a COM port on the computer. A 9-pin to 25-pin adapter will be required if your computer has a 25-pin serial port connector.

The program “HyperTerminal<sup>®</sup>” which comes with Microsoft Windows<sup>®</sup> can be used for capturing data sent by the micromanometer. To send data from the micromanometer, use the printing function of the micromanometer, as shown above.

The program “LogDat<sup>™</sup>” which comes with your micromanometer can be used to assist in downloading data to a Windows<sup>®</sup>-based computer and formatting that data. To install LogDat software, run the SETUP.EXE file on the LogDat distribution disc. Once you open the program, it is self-directing and provides all the necessary instructions for downloading data.

## Data Acquisition (Polling)

---

The micromanometer is designed to allow the user to perform polling through the use of a computer. The computer must send an upper case ‘V’ to the micromanometer while the micromanometer is taking measurements. The ‘V’ must be sent alone, without a carriage return or linefeed. The micromanometer will then output the values of the last measurements read. Note that the ‘V’ polling command will not start the micromanometer taking new measurements, therefore, it works much better if the micromanometer display mode is set to RUNAVG.

You must write your own program to use the ‘V’ polling command. Therefore this command is only designed for medium-to-advanced programmers who need real-time data acquisition. The ‘V’ polling command cannot be used to request logged data.

---

<sup>®</sup>HyperTerminal is a registered trademark of Hilgraeve, Inc.

<sup>®</sup>Windows is a registered trademark of Microsoft Corporation.

# Chapter 5. Maintenance and Troubleshooting

The Model 8710 Micromanometer is designed for long-term field use. If used with reasonable care, it should be able to make precise measurements over a long time period. Some of the components can be cleaned periodically. When cleaning the components, please follow the instructions given below.

---

## Micromanometer

---

The micromanometer case, display screen and keys can be cleaned using a damp cloth with mild detergent solution. Do **not** immerse it in water. Wipe the unit dry before use.

---

## Velocity Matrix Manifold

---

If you observe the flow sensing taps of the manifold becoming clogged with dust or other material, clean them with a damp cloth. The manifold should be kept in place during cleaning. Do **not** apply excessive forces on the grid of the manifold. If any part of the grid is damaged, please contact Customer Service for repair information.

### Cases

If the instrument case or storage case needs cleaning, wipe it off with a soft cloth and isopropyl alcohol or a mild detergent.

---

## Calibration

---

TSI recommends an annual calibration for the instrument. For a nominal fee, we will calibrate the unit and return it to you with a certificate of calibration and NIST traceability. This “annual checkup” assures you of consistently accurate readings. To calibrate the instrument, please ship the complete package that includes the meter, the base, the manifold and any fabrics used. Everything should be packed carefully within the carrying case and then inside a shipping box. The original shipping box is preferred. Prior to shipment, please contact Customer Service for an RMA (Return Materials Authorization) number at (651) 490-2811, (800) 874-2811 or visit the Service page our website at [www.tsi.com](http://www.tsi.com) to complete an RMA# form online.

Ship directly to:            TSI Incorporated  
                                      ATTN: Customer Service  
                                      500 Cardigan Road  
                                      Shoreview, MN 55126-3996

Tables 3 and 4 list the symptoms, possible causes, and recommended solutions for common problems encountered with the instrument. If your symptom is not listed, or if none of the solutions solves your problem, please contact the factory.

**Table 3: Troubleshooting the Instrument**


Symptom	Possible Causes	Corrective Action
No display	Unit not turned on.  Low or dead batteries.  Dirty battery contacts.  AC adapter not connected.	Press I/O key.  Replace the batteries.  Clean the battery contacts.  Plug in AC adapter.
 flashing on display	Low battery charge.  Dirty battery contacts.	Replace or recharge the batteries. Clean the battery contacts.
“888888” flashing on display	The pressure is too high to measure. This same display is shown if measuring velocity or flow and the pressure at that velocity is too high.	The maximum pressure is shown on the specifications page.
“8888” flashing on display	The temperature is too high to measure.	The maximum temperature is shown on the specifications page.

Table 4 lists the possible error codes and their meanings. All error codes are preceded by ‘ERR.’

**Table 4: Error Codes**

Error Code	Possible Causes	Corrective Action
10	The AC adapter voltage is too low. The NiMH batteries will not recharge fully with low AC adapter voltage.	Use correct AC adapter.
11	The AC adapter voltage is too high. The NiMH batteries will not fast-charge with high AC adapter voltage.	Use correct AC adapter.
12	Model number checksum error.	Return to factory.
13	Serial number checksum error.	Return to factory.
14	Accessory temperature/humidity probe checksum error for humidity.	Perform user calibration or return to factory.
15	Accessory temperature/humidity probe checksum error for temperature.	Perform user calibration or return to factory.
16	Accessory temperature probe calibration checksum error.	Perform user calibration or return to factory.
18	Pressure sensor calibration checksum error.	Perform user calibration or return to factory.
19	A to D converter calibration checksum error.	Return to factory.
20	Barometric pressure sensor calibration checksum error.	Return to factory.

<b>Error Code</b>	<b>Possible Causes</b>	<b>Corrective Action</b>
30	Pressure calibration voltage at 1 in. H <sub>2</sub> O must be less than pressure calibration voltage at 5 in. H <sub>2</sub> O.	Make sure calibration pressures are correct.
31	Pressure calibration voltage at 5 in. H <sub>2</sub> O must be less than pressure calibration voltage at 15 in. H <sub>2</sub> O.	Make sure calibration pressures are correct.
32	While performing user calibration of accessory temperature/humidity probe, the correct probe was not found.	The accessory temperature/humidity probe was either not plugged in or is faulty.
33	While performing user calibration of accessory temperature sensor, the accessory temperature/humidity probe was found instead.	Plug in the selected probe.
34	Barometric pressure measured was <15.00 in. Hg.	The barometric pressure is too low to take a reading.
35	Barometric pressure measured was >40.00 in. Hg.	The barometric pressure is too high to take a reading
36	Flap closed pressure was < flap open pressure, or flap open versus flap closed pressure ratio exceeds allowed limits.	Take data again.
37	There was an error reading the AD7708 A to D converter.	Return to factory if error re-occurs.
38	There was an error reading the AD7718 A to D converter.	Return to factory if error re-occurs.
39,40, 41,42	Error in logged data.	If using accessory temp/humidity probe, make sure probe securely connected. Erase logged data.
43	Could not send RS232 data because the receiving device was busy >10 seconds.	Make sure printer or computer is ready to receive. Check RS232 interface cable.
50	Pressure sensor zero voltage is too high.	Return to factory if error re-occurs.
51	Pressure sensor gain out of range.	Perform user calibration or return to factory.
52	Lithium battery voltage is too low.	Replace lithium battery or return to factory.
53	AD7708 A to D converter calibration factor out of range.	Return to factory.
54	AD7718 A to D converter calibration factor out of range.	Return to factory.
55	User entered flow temperature out of range.	The micromanometer has reset the temperature to 70.0°F (21.1°C) to correct it.

<b>Error Code</b>	<b>Possible Causes</b>	<b>Corrective Action</b>
56	Barometric pressure zero factor out of range.	Return to factory.
57	Barometric pressure span factor out of range.	Return to factory.
58	Offset factor for user temperature sensor calibration out of range.	Re-do user calibration, set temperature sensor calibration to FACT, or return to factory.
59	Slope factor for user temperature sensor calibration out of range.	Re-do user calibration, set temperature sensor calibration to FACT, or return to factory.
60	Humidity sensor voltage at 20% RH out of range.	Perform user calibration or return to factory.
61	Humidity sensor voltage at 80% RH out of range.	Perform user calibration or return to factory.
62	Pressure sensor gain factor A out of range.	Perform user calibration or return to factory.
63	Pressure sensor gain factor B out of range.	Perform user calibration or return to factory.
64	Pressure sensor gain factor C out of range.	Perform user calibration or return to factory.
68	Pressure sensor divider calibration out of range.	Return to factory.
69	A to D reference voltage out of range.	Return to factory.
70	5V reference voltage out of range.	Return to factory.
71, 72	An invalid K-Factor was corrected.	The micromanometer has set the K-factor to 1.0 to correct it.
74	Pressure voltage for user pressure calibration out of range.	Re-do user calibration.
75	User temperature calibration >5°F (3°C) different from factory calibration.	Re-do user calibration. Replace temperature probe.
>100	Internal program error.	Please contact the factory.

# Appendix A. Actual vs. Standard Air Velocity and Flow Measurements

**Actual Air Velocity** is also known as the “local” air velocity. It can be thought of as the speed of a microscopic dust particle being carried along in the air stream.

Actual Air Velocity is measured with a Pitot tube using the basic formula:

$$V_{ACT} = 1096.7 \times \frac{\sqrt{VP}}{\rho_{air}} \quad \text{Eq. (1)}$$

where:  $V_{ACT}$  is Actual Air Velocity, in units of (Actual Feet per Minute)  
VP is Velocity Pressure, measured in units of (in. H<sub>2</sub>O)  
 $\rho_{air}$  is the air density, in units of (lb<sub>m</sub>/ft<sup>3</sup>)

Air density,  $\rho_{air}$ , can be calculated from the equation:

$$\rho_{air} = 1.325 \times \frac{P_{ACT}}{T_{ACT} + 460} \quad \text{Eq. (2)}$$

where:  $P_{ACT}$  is the atmospheric pressure, in units of (in. Hg)  
 $T_{ACT}$  is the local air temperature, in units of (°F)

**Standard Air Velocity** is also known as the mass velocity of air. It can be thought of as the local air velocity corrected to standard conditions of air. Standard Conditions are defined as air at 70°F and  $P_{STD} = 29.92$  in. Hg.

Substituting Standard Conditions into Eq. (2) above we can see that:

$$\rho_{air_{STD}} = 1.325 \times \frac{29.92}{70 + 460} = 0.0748 \frac{\text{lb}_m}{\text{ft}^3} \quad \text{Eq. (3)}$$

Standard Air Velocity and Standard Air Flow are often the preferred units of measure when evaluating Heating, Ventilating and Air-Conditioning (HVAC) system performance because the heat-carrying capacity (and cooling capacity) of air is directly related to Standard, not Actual, units of measure.

Converting between Standard and Actual units of measure simply involves an inverse air density ratio, as follows.

From the continuity of mass equation, we can state the following:

$$\rho_{air_{ACT}} \times V_{ACT} = \rho_{air_{STD}} \times V_{STD} \quad \text{Eq. (4)}$$

Thus, to convert from Actual Velocity to Standard Velocity, use the following equation:

$$\frac{\rho_{\text{airACT}}}{\rho_{\text{airSTD}}} \times V_{\text{ACT}} = V_{\text{STD}} \quad \text{Eq. (5)}$$

Substituting known values into Eq. (5), we get:

$$\frac{P_{\text{ACT}}}{T_{\text{ACT}} + 460} \times \frac{70 + 460}{29.92} \times V_{\text{ACT}} = V_{\text{STD}}$$

or,

$$V_{\text{ACT}} \times \frac{P_{\text{ACT}}}{T_{\text{ACT}} + 460} \times 17.714 = V_{\text{STD}} \quad \text{Eq (6)}$$

where:  $P_{\text{ACT}}$  is the local atmospheric pressure, as measured by the micromanometer, for example, in units of (in. Hg)

$T_{\text{ACT}}$  is the local temperature of the air flow being measured, in units of (°F)

$V_{\text{ACT}}$  is Actual Air Velocity, in units of (AFPM)

$V_{\text{STD}}$  is Standard Air Velocity, in units of (SFPM)

Similarly, to convert from Standard to Actual Air Velocity, use the following equation:

$$V_{\text{STD}} \times \frac{T_{\text{ACT}} + 460}{P_{\text{ACT}}} \times 0.05645 = V_{\text{ACT}} \quad \text{Eq (7)}$$

For Volumetric Flow measurements, the analysis is exactly the same.

Thus:

$$\text{Flow}_{\text{ACT}} \times \frac{P_{\text{ACT}}}{T_{\text{ACT}} + 460} \times 17.714 = \text{Flow}_{\text{STD}} \quad \text{Eq (8)}$$

$$\text{Flow}_{\text{STD}} \times \frac{T_{\text{ACT}} + 460}{P_{\text{ACT}}} \times 0.05645 = \text{Flow}_{\text{ACT}} \quad \text{Eq (9)}$$

where:  $\text{Flow}_{\text{ACT}}$  is Actual Air Flow, in units of (ACFM)

$\text{Flow}_{\text{STD}}$  is Standard Air Flow, in units of (SCFM)

**Note:** *The Model 8170 performs these calculations automatically. You can choose to view velocity or flow measurements in either “Actual” or “Standard” units of measure.*

# Model 8710 DP-CALC™ Micromanometer

## Specifications\*

<b>Range</b>		<b>Units</b>	
Differential pressure...	±15 in. H <sub>2</sub> O (3735 pa); 150 in. H <sub>2</sub> O maximum safe operating pressure	Pressure .....	in. H <sub>2</sub> O, pa, hPa, kPa, mm Hg, in. Hg, cm Hg, mm H <sub>2</sub> O, cm H <sub>2</sub> O
Absolute pressure.....	15 to 40 in. Hg (356 to 1016 mm Hg)	Velocity .....	ft/min, m/s
Velocity .....	25 to 8,000 ft/min (0.125 to 40 m/s) pitot probes; 25 to 5,000 ft/min (0.125 to 25 m/s) air flow probe; 25 to 2,500 ft/min (0.125 to 12.5 m/s) velocity matrix	Volume .....	ft <sup>3</sup> /min, m <sup>3</sup> /h, m <sup>3</sup> /min, l/s
Temperature .....	-40 to 250°F (-40 to 121°C) temperature probe 14 to 140°F (-10 to 60°C) temperature/RH probe 40 to 140°F (4.4 to 60°C) operating (electronics)	Temperature .....	degrees F, degrees C
Storage temperature...	-4 to 160°F (-20 to 71°C)	<b>Statistics .....</b>	min, max, average up to 1000 readings
Rh.....	0 to 95% RH temperature/RH probe	<b>Data Storage .....</b>	1000 readings, time and date stamped
<b>Resolution</b>		<b>Logging Interval .....</b>	user selectable (10 to 600 seconds)
Pressure .....	0.00001 in. H <sub>2</sub> O (0.001 pa) static and differential; 0.01 in. Hg (1 mm Hg) absolute	<b>Response Time.....</b>	2 to 8 seconds
Velocity .....	1 ft/min (.01 m/s)	<b>Display .....</b>	6 digit, 0.75 in. character height, multi-line, sectored, multiple symbolic icons, high-contrast backlit LCD
Volume .....	1 ft <sup>3</sup> /min (1 m <sup>3</sup> /h)	<b>Dimensions</b>	
Rh.....	0.1% RH	(manometer only) .....	7.4 in. × 4.5 in. × 2.3 in. (18.8 cm × 11.4 cm × 5.8 cm)
Temperature .....	0.1°F (0.1°C)	<b>Pressure connection...</b>	¼ in. OD straight ports for use with 3/16 in. ID flexible tubing
<b>Accuracy</b>		<b>Weight with batteries ..</b>	8710 DP-CALC 17 oz (0.5 kg)
Pressure .....	±2% of reading ±0.001 in. H <sub>2</sub> O (0.25 pa) static and differential; ±2% of reading absolute	<b>Power requirements....</b>	four AA-size cells, rechargeable NiMH (included) or alkaline, or AC adapter (included), 7.5 VDC, 1.6 A, regulated
Velocity .....	±3% of reading ±7 ft/min (0.04 m/s) >50 ft/min (>0.25 m/s)	<b>Battery life.....</b>	minimum of 12 hours typical
Volume .....	±3% of reading ±7 ft <sup>3</sup> /min (12 m <sup>3</sup> /h) >50 ft <sup>3</sup> /min (>85 m <sup>3</sup> /h)	<b>Recharge time.....</b>	1 hour (external charger); 4 hours (internal charger)
Rh.....	±3% RH	<b>RS232C output .....</b>	ASCII character codes; 1200, 2400, 4800, 9600, 19200 baud rate (selectable) no parity 8 data bits 1 stop bit no handshaking
Temperature .....	±0.5 °F (0.3°C) from 32 to 160°F (0 to 71°C); max ±2.0 °F (1.2°C) from -40 to 32°F (-40 to 0°C) and from 160 to 250°F (71 to 121°C)	<b>Warranty.....</b>	2 year factory warranty

\*Specifications are subject to change without notice.



**TSI Incorporated**

**Headquarters—Tel:** +1 651 490 2811 **Toll Free:** 1 800 874 2811 **E-mail:** [info@tsi.com](mailto:info@tsi.com)

**UK** **Tel:** +44 1494 459200 **E-mail:** [tsiuk@tsi.com](mailto:tsiuk@tsi.com) **France** **Tel:** +33 491 95 21 90 **E-mail:** [tsifrance@tsi.com](mailto:tsifrance@tsi.com)

**Germany** **Tel:** +49 241 523030 **E-mail:** [tsigmbh@tsi.com](mailto:tsigmbh@tsi.com) **Sweden** **Tel:** +46 8 595 13230 **E-mail:** [tsiab@tsi.com](mailto:tsiab@tsi.com)

**India** **Tel:** +91 80 41132470 **E-mail:** [tsi-india@tsi.com](mailto:tsi-india@tsi.com) **China** **Tel:** +86 10 8260 1595 **E-mail:** [tsibeijing@tsi.com](mailto:tsibeijing@tsi.com)

